

TECHNICAL INFO

RENAULT

○ Type of vehicle

Renault Scenic/Grand Scenic II

○ Vehicles in question

All models with ESP.

Mégane Scénic:

Type JAO 1, VIN D 000002-000006/JAO 5, VIN D 000099-367831.

Type JAO B, VIN D 300001-355164/JAO C, VIN D 034003-045379.

Type JAO D, VIN D 260000-271432.

Scénic:

Type JA1 0, VIN D 000006-000162/JA1 1, VIN D 000003-002040.

Type JA1 3, VIN D 000013/JA1 A, VIN D 260127-261627.

Type JA1 H, VIN D 000001-001441/JA1 J, VIN D 260000-271318.

Type JA1 R, VIN D 000001-000021/JA1 S, VIN D 000001-000010.

Type JA1 U, VIN D 260001-273263.

● PROBLEM

When starting the engine the ESP warning light illuminates. Error code saved: DEF 74 (concerning the steering angle sensor).

○ Cause of the problem

The battery voltage is too low when starting the engine.


○ Fault elimination

! Don't remove the steering angle sensor.

Remove the fuse box from the instrument panel. Pull the fuse F16 ABS and the back-up fuse F26. Interconnect the slots F16 and F26 with the shunt.

Put the fuses on the shunt. Check the ESP warning light for function.

- With the ignition on the ESP warning light illuminates.
- Operating the starter the ESP warning light goes out.
- Engine starts, release car ignition key
- The ESP warning light illuminates for a period of 3 s before going out.

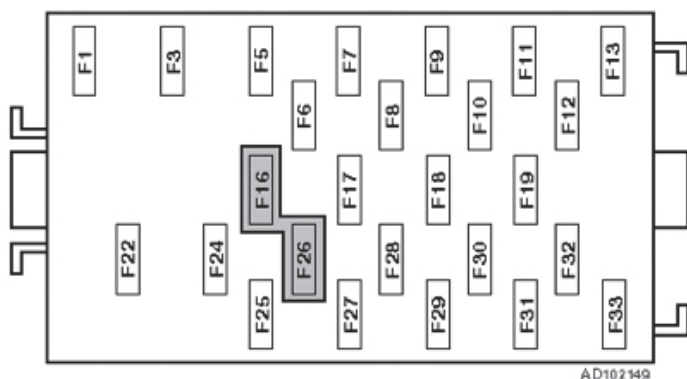

○ Spare parts

Shunt for ESP, spare part number: 7701054996