

# TECHNICAL INFO

## BMW

### ○ Type of vehicle

BMW X5 (E53), 3,0i, 30 6D 2, 155kw (211 hp) at 4000 rpm, year of construction 2003-2007

### ○ Vehicles in question

All models.

### ● PROBLEM

The ABS warning light illuminates.

Error code(s) concerning the ABS wheel speed sensor.

### ○ Cause of the problem

A short-circuit was caused by the wiring harness scraping against the vehicle chassis.

### ○ Fault elimination

It is recommended to check the wiring harness for damage and to repair possible damages.

### ○ Type of vehicle

BMW X5 (E70), 3,0i SI/ xDrive30i, N52 B30A, 200kw (272 hp) at 6650 rpm, R-Cat, year of construction 2006-2010

### ○ Vehicles in question

All models until year of construction 2008 (august).

### ● PROBLEM

The EPB warning light illuminates.

Error codes saved: 600 D, 600 B.

### ○ Cause of the problem

There is a software error in the EPD control unit.

### ○ Fault elimination

To exclude other causes of problems, further electrical and mechanical system tests should be carried out. If there are no other errors present it is recommended to program the EPB control unit with the current software. In case you need any further information don't hesitate to contact the manufacturer (An upgrade is required).

# TECHNICAL INFO

## BMW

### ○ Type of vehicle

BMW 7 Series (E65/66), 3,0l SI/ xDrive30i, N52 B30A, 190kw (258 hp) at 6600 rpm, R-Cat, year of construction 2005-2008

### ○ Vehicles in question

All models.

### ● PROBLEM

Squeaking noises, coming from front and rear brakes, occur during slight brake activation.

### ○ Cause of the problem

The brake pad wear sensor scrapes against the brake disc.

### ○ Fault elimination

It is recommended to install an amended brake pad wear sensor. Furthermore the brake pads should be checked and, if necessary, replaced.

### ○ Spare parts

Brake pad wear sensor (front), spare part number:

34356778037 - Brembo A 00 236

Brake pad wear sensor (back), spare part number:

34356778038 - Brembo A 00 237